

The Analysis Factors of Kelayan's Riverside Settlement Causes Slum in the City of Banjarmasin

by Annisa Yuniar

Submission date: 03-Jun-2020 01:01PM (UTC+0300)

Submission ID: 1337011276

File name: Riverside_Settlement_Causes_Slum_in_the_City_of_Banjarmasin.doc (6.82M)

Word count: 4840

Character count: 25155

The Analysis Factors of Kelayan's Riverside Settlement Causes Slum in the City of Banjarmasin

Annisa Yuniar

*Departement Architecture, University of Nahdlatul Ulama Kalimantan Selatan
Email: annisayuniar90@gmail.com*

Abstract (Indonesian):

Kota Banjarmasin adalah ibukota Provinsi Kalimantan Selatan yang dikenal sebagai Kota Seribu Sungai. Namun, sekarang permukiman tepian sungai Kota Banjarmasin sudah tidak terkendali dan hampir seluruh permukiman yang berada di area tepian sungai pada setiap kelurahan termasuk dalam kategori kawasan kumuh. Kawasan kumuh tepian sungai umumnya terbentuk karena banyaknya bangunan yang tidak beraturan dan melanggar garis sempadan sungai serta kebiasaan masyarakat yang tinggal di tepian sungai, seperti membuang sampah ke sungai dan melakukan aktifitas mandi, cuci dan kakus (MCK) di sungai. Saat ini Pemerintah Kota Banjarmasin sedang fokus pada program penanganan untuk mengurangi luasan kawasan kumuh melalui gerakan 100-0-100 yang mana 100% untuk pelayanan air minum, 0% untuk luas kawasan kumuh dan 100% untuk akses sanitasi. Tujuan penelitian ini adalah membuat pola penanganan permukiman kumuh yang sesuai dan dapat dilaksanakan pada kawasan kumuh tepian sungai di lokasi penelitian. Analisis data dilakukan dengan metode deskriptif kualitatif dengan pendekatan studi kasus. Teknik pengumpulan data dengan observasi lapangan, kuisioner dan wawancara. Teknik sampling dilakukan dengan metode simple random sampling untuk penentuan sampel pada lokasi penelitian. Hasil penelitian menunjukkan bahwa faktor dominan kawasan kumuh tepian sungai kelayan adalah ketidakteraturan bangunan, tidak adanya pengelolaan sampah dan tidak tersedianya pengelolaan air limbah.

Kata Kunci: Kawasan Kumuh, Tepian Sungai, Banjarmasin

Abstract (English):

Banjarmasin is the capital city of South Borneo province which known as city of one thousand rivers. But nowadays the expansion of riverside localities of Banjarmasin are uncontrolled and almost all of the areas are slums. Slum areas riverside commonly formed by many unorganized building that exceed the river's borderline and the riverside localities' behaviors such as throwing the garbage and taking a bath at the river. Our government now focused on handling program to overcome the expansion of riverside slum areas by 100-0-100 movement which means 100% for the water service, 0% for slum area expansion and 100% for sanitation accessibility. Data analysis was descriptive qualitative method with case study approach. Data were collected with observation, questionnaire and interview. Sampling technique was simple random sampling for sample in research location. Result shows that the dominant factors of slum areas at kelayan riverside are unorganized buildings, uncontrolled garbage and waste management.

Keywords: Slum Area, Riverside, Banjarmasin

1. INTRODUCTION

Banjarmasin City is well known as a thousand rivers. According to its history, the first idea of Banjarmasin has formed from the riverside settlement. The people that live in such time was establishing their houses near the riverside, because of their activity that tend to follow the rivers area. The houses that stay in the riverside were aligned to the shape of the river, the settlement of riverside of Banjarmasin is actually the settlement that lives accordingly to the characters and locality element (Mentayani, 2016). The locality characters are pictured in the river custom and the wetland structures. This settlement's pattern is the utmost concern to the ecosystem balance, because it is still consider the river as the natural resources (Dahliani, 2012). However, nowadays, the riverside settlement of Banjarmasin city has uncontrollable condition and almost all the region of riverside in every each of the districts is categorized as the slums area. At first, the riverside area was the locality characteristic of Banjarmasin city, otherwise it is becoming the bad image for the city because of uncountable slums area in the land or in the riversides.

From the phenomenon that occur on those settlement area of Banjarmasin, the government of Banjarmasin has released the regulation about Slums that function to control and eliminate the growing of slums in Banjarmasin city. According to the Slum's regulation of Banjarmasin year 2015, Banjarmasin has the slum area around 549,7 hectares categorized as small slum, medium, and heavy. The slum area of Banjarmasin is divided into 2 typologies, such as slum area in central of the city with 320.26 hectares wide and slum area in the riverside with 229.44 hectares or around 41.74% from the total of whole slum areas.

The slum area of the riverside is commonly shaped because of the disorganized establishment and violated the border line of riverside also the habit of the people that live on the riverside such as thrashing on the river and doing the activity such shower, and defecate in the river. If spotted from the map of slum area of Banjarmasin, predominantly the area would be on the southern area of Banjarmasin and that is located on the Kelayan's river that passes several districts, such as Kelayan Luar, Kelayan Barat, Kelayan Dalam, Kelayan Tengah and Murung Raya districts. The river is the life source for the people that live in the riverside of Kelayan. There are many activities in the river from showering, cleaning, fishing until the transportation for the merchants as their way to mobility and station of pick-ups the passengers on the harbour. The more it is growing population of the people, the more the river life is getting recessive. The pattern of settlement that align to the riverside becoming the river as the back of their home and polluting the river of Kelayan of south Banjarmasin district. Based on the backgrounds explained above, it can be drawn the factors that caused the slum on the Kelayan riversides of Banjarmasin city.

According to Budiharjo in Heryati (2008) the slum areas is the low-quality environment and uninhabitable, the character is located on the area that adjustable to the regulation of layout, building density that is very high in limited width, diseases and social prone, also the low quality of the establishment, zero availability of environmental facilities and endangering the ecosystem and the life of the society.

Kelayan's river in the regional regulation number 5 about the RTRW of Banjarmasin (2013) mentioned as the protection areas that gives the protection to underline areas such as the water infiltration areas. As the water infiltration area, according to clause number 44 it is not allowed to any of activity of farming that causes the disruption to the river function and the settlement that has already established inside the water infiltration area before the regulation has legally stamped is allowed, however it is not allowed to increase more establishment. Hence, the settlement area is not allowed to be established in the protection areas.

2. RESEARCH'S LOCATION AND METHOD

The research is conducted in the city of Banjarmasin, South Kalimantan Province. In the Statistics of Banjarmasin year 2016, Kelayan's river has the length of 3.227 meters and 26 meters width. Kelayan's river geographically is located in the southern of Banjarmasin city. Kelayan Barat, Kelayan Luar, Kelayan Tengah, Kelayan Dalam and Murung Raya are the districts that passed by and used the Kelayan's river as the administrative boundaries. In the following map is the administration Kelayan's riverside and the deployment of slum area map:



Figure 1. Slum area location map of Kelayan's Riverside

To support the analysis, it is needed the primary data. This phase will be conducted by the data collecting in accordance to the material coverage. The method that used in the secondary data collection is to collect the data that acquired from the related agencies or from the necessary literatures. In addition, the primary data is conducted through the field observation.

Table 1. The field data observation type

Data type	Procedure to collect the data	Data usage	Output
Physical condition of Kelayan's riverside	Observing the physical condition based on the slum indicators: -buildings, -lanes, -drainage condition, -water provision, -water waste management, -waste management, -fireproof protection	Used in the preliminary analysis related to the dominant factors that cause the slum	Physical condition of Kelayan's riverside and dominant factor that cause the riverside slum

For the primary data necessity is conducted the simple randomize sample with the slovin formula and the margin of error to 5%. The family clusters that become the sample is decided by the sub-districts around 442 householders. After it has counted with slovin formula in each of the subdistricts, the number of householders that become the sample is 366 householders.

This following table is the list of sources and informant also the list of necessity information from the sources and informants.

Tabel 2. Informants list

Technique of sample	Sources/ Informants	Required Information	Data Usage
Simple Random Sampling $n=N/N(d)^2+1$	The people of Kelayan's riverside: - Kelayan Barat RT. 3 district (50 householders) - Kelayan Barat RT. 4 district (28 householders) - Murung Raya RT. 17 districts (88 householders) - Kelayan Tengah RT. 8 districts (13 householders) - Tanjung Pagar RT. 22 districts (55 householders) - Tanjung Pagar RT. 5 districts (61 householders) - Tanjung Pagar RT. 6 districts (61 householders)	Primary data (variable and sub variable)	To discover the condition in the field of every houses on the riversides.

The analysis method that is used in this study in quantitative with the case-study approach. Quantitative analysis is used to discover the dominant factors of the Sungai Kelayan's riverside slum area, after conducted the questionnaire then analysed with the scoring in every indicators based on parameters and scored that has been taken from government regulation of PUPR number 2 year 2016. Then, it is discovered that the dominant factors that cause the slum in research location. Based on the sample of the data that has been taken, the result of the analysis that acquired will be tested hypothetically for the proportion in order to figure out the data that has been acquired has already valid and can be used.

3. RESULT AND DISCUSSION

3.1 Physical Analysis Aspect of the Slum Indicator

There are several physical indicator aspects, such as the building's regularity, building occupancy's density, the properness of building's occupancy, accessibility to surrounding, environment drainage, drinkable water provision, water sewage management, waste management and fire hazard securement alert. This physical indicator aspects then divided into several categories which carried out the final scores or each of indicators percentages. Scores or percentages of each indicators are used as the score for slum area factors.

3.1.1 Building's Regularity

.Building's Regularity is one of the aspect of physical indicator for slum. The percentages of building's regularity valued as 0 if the building unit hold on the border of the river and it is not face toward the river (does not have two way door accessibility), it does not have the accessibility to the road and it is not face toward the road also stay in waste area/factory waste/high voltage electricity. Here are the result of questionnaire scores toward the aspect of building's regularity in district Kelayan Barat, Kelayang Tengah, Murung Raya and Tanjung Pagar.

The Analysis Factors of Kelayan's Riverside Settlement Causes
 Slum in the City of Banjarmasin
 Annisa Yuniar

Table 3. Buildings Regularity

District	Sub-district Number (RT)	Amount of Buildings (unit)	Amount of the building that has the regularity (unit)	Score of Building's Regularity
Kelayan Barat	3	50	0	0
	4	28	7	1.91
Murung Raya	17	88	0	0
Kelayan Tengah	8	13	7	1.91
	22	55	3	0.81
Tanjung Pagar	5	61	20	5.64
	6	71	0	0
Total		366	37	10.11

From above analysis, the building's regularity lowest point is on 0% which is RT. 3 Kelayan Barat district, RT. 17 Murung Raya District and RT. 6 Tanjung Pagar district. Hence, the building's regularity score to this riverside settlement is 90%.

3.1.2 Building Occupancy's Density

Building occupancy's density is the division among the amount of building to the settlement width. In the Rencana Tata Ruang Wilayah (RTRW)/ Spatial-layout plans design of Banjarmasin city, the status of building occupancy's density on the district of Kelayan Barat, Kelayan Tengah, Tanjung Pagar and Murung Raya can be seen in this picture.

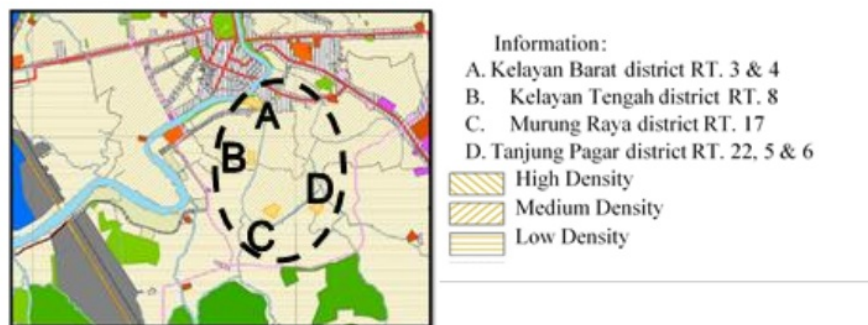


Figure 2. Building Occupancy's density

From the picture above, the status of building occupancy's density on Kelayan Barat district and Kelayan Tengah district have the status of high density, on Murung Raya district has the status of medium capacity houses, on the Tanjung Pagar district the status of house is low. However, this status is not possibly will stay the same in years as the amount of the building's occupancy will grow according to the amount of population per year.

From the slum area parameter, it can be conclude that the building's density that become the parameter is the building that has disintegrate with the regulation or has the high density such as the buildings that stand in Kelayan Barat district and Kelayan Tengah. The building's density can be seen in this following picture.

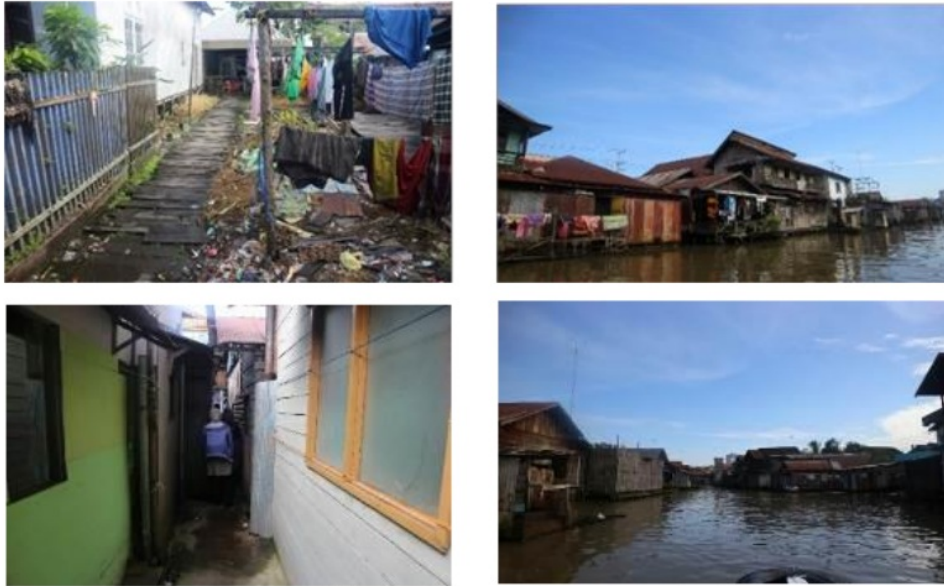


Figure 3. Building Occupancys's Density on Kelayan Riverside

From the pictures above, we can find that the building occupancy's density in every each of the RT slum riverside is slight densed and disorganized. The buildings that stay in the riverside has multiple layers, and in between of this density there is found a small lane access to the river such as pavement made from woods/logs. The highest density of building is located in Kelayan Barat and Kelayan Tengah district with the amount of building in the riverside are 103 units, therefore the total of building occupancy in the research location is 452 units. In conclusion, 22% of the building occupancy that cover the high density.

3.1.3 The Properness of Building's Occupancy

The properness of building's occupancy is scored by the width of the building/person whereas the score of properness of this building will scored 100% if the width of the building's occupancy $\geq 7,2$ meter square/person. The score of properness of bulding's occupancy can be seen in this following table 4.

Table 4. The properness of Building's Occupancy

District	Sub-district Number (RT)	Amount of Buildings (unit)	The amount of buildings with the width of the building's occupancy/person (≥ 7.2 m ² /person)	The properness of Building's score (%)
Kelayan Barat	3	50	29	7.92
	4	28	20	5.46
Murung Raya	17	88	63	17.21
Kelayan Tengah	8	13	13	3.55
Tanjung Pagar	22	55	46	12.57
	5	61	43	11.75
	6	71	34	9.29
Total		366	248	67.76

The Analysis Factors of Kelayan's Riverside Settlement Causes
Slum in the City of Banjarmasin
Annisa Yuniar

The properness of the building's occupancy based from analysis above is showing that 67% of the building is proper. Therefore, the building that is inhabitable in the riverside settlement is 33%. If it is seen from the slum parameter, the number of 33% is hold the value of 25%-50% in the building location that is not proper, so that the score is 1.

3.1.4 Accessibility to Surrounding

Accessibility to surrounding is scored with two distinguish categories, which are system coverage to the feasible road and the road that is in accordance to the technical requirements. System coverage to the feasible road is scored as 100% if the length of the road with width of $\geq 1,5$ meters and hardened surface. The system coverage to feasible road that is in accordance with the technical requirements can be seen in this following table.

Table 5. Accessibility to Surrounding

District	Sub-district Number (RT)	Total Road Coverage (meter)	The length of the road with width >1.5 meter that hardened surface (meter)	System coverage to feasible road (%)
Kelayan Barat	3	418	310	8.73
	4	263	199	5.60
Murung Raya	17	645	455	12.81
Kelayan Tengah	8	178	178	5.01
	22	678	535	15.07
Tanjung Pagar	5	534	312	8.79
	6	835	432	12.17
Total		3551	2421	68.18

In the results of the above analysis, the coverage of the road system that is said to be feasible in Kelayan Barat Kelurahan, Murung Raya, Kelayan Tengah and Tanjung Pagar with a width of more than 1.5 meters and hardened surface is 68% and for the value of an unfeasible network coverage is equal to 32%. The number shows that the score for one of these aspects is 1.

3.1.5 Environmental Drainage

Environmental drainage is obtained from the calculation of the area of inundation areas in settlements and drainage length with conditions that are not damaged / functioning well. In the flooded area can be analyzed from the inundation height, inundation duration, inundation frequency in years and inundation sources. The drainage analysis is obtained from the total drainage length and which is still functioning properly. The results of the analysis can be seen in the following table.

Table 6. Environmental Drainage

District	Sub-district Number (RT)	Inundation Height (ha)	Drainage availability (in the pavement/primary drainage)	Percentage of Area There is no Inundation in Settlement (%)
Kelayan Barat	3	0	Available	100
	4	0	Available	100

Murung Raya	17	0.3	Available	71
Kelayan Tengah	8	0	Available	100
Tanjung Pagar	22	0	Available	100
	5	0	Available	100
	6	0	Available	100

From the results of the analysis above, almost all slum sub-districts do not have problems with inundation. The subdistricts also have drainage that is on the edge of the road / along the Kelayan A and Teluk Kelayan roads.

3.1.6 Drinking Water Services

There are several main sources of water for drinking, bathing and washing running water, running water without the watermeter, drilled-well, protected well, rain water and others. To analyze the score of water needs can be seen from the adequacy of drinking water, bathing, washing throughout the year. The analysis can be seen in the following Table 7.

Table 7. Drinking Water Services

District	Sub-district Number (RT)	Amount of the Buildings	Air Amount of people with accessible water	Accessibility water score (%)
Kelayan Barat	3	50	50	100
	4	28	28	100
Murung Raya	17	88	88	100
Kelayan Tengah	8	13	13	100
Tanjung Pagar	22	55	55	100
	5	61	61	100
	6	71	48	67
Total		366	343	93

From the results of the analysis, all buildings have access to get water. Then, the water access score is 100% and for RT. 6 67% of Tanjung Pagar district can access water because they still do not have PDAM's (Local Water Distillation Company) connections. So, the value of households that can access water on the banks of the Kelayan River is 93%. From these results, the drinking water service which is assessed from the access and fulfilment of drinking water needs in riverside settlements has been fulfilled.

3.1.7 Water Sewage Management

At this stage of the analysis, the assessment is based on toilet facility access and the technical feasibility score of toilet facilities. For access score toilet facilities households, they use their own water closet, public toilets or do not have any water closet. The toilet facility access score will give a value of 100% if each household has its own toilet. The technical feasibility of toilet facilities is can be seen from the type of toilet used, as well as waste disposal facilities. The technical feasibility score for the toilet facility will be valued 100% if the type of toilet used is the *goose neck* type and waste disposal in the form of private / communal septic tank. The results of the analysis can be seen in Table 8 below.

Table 8 Toilet Access Facility

The Analysis Factors of Kelayan's Riverside Settlement Causes
 Slum in the City of Banjarmasin
 Annisa Yuniar

Table 8. Toilet Access Facility

District	Sub-district Number (RT)	Amount of Building	Amount of Building that has toilet	(%) Toilet Access Facility Score (%)
Kelayan Barat	3	50	33	9.02
	4	28	5	1.37
Murung Raya	17	88	88	24.04
Kelayan Tengah	8	13	10	2.73
Tanjung Pagar	22	55	48	13.11
	5	61	49	13.39
	6	71	66	18.03
Total		366	299	81.69

To access toilet facilities, the community already has a private toilet with a score of 81%. Only a few houses do not have access to private toilets, they use public toilets that are on the river. From the analysis of the access chapter above, then proceed with the disposal system used. Waste management facilities used to assess the technical feasibility of toilet facilities. The following table water sewage management.

Table 9. Water Sewage Management

District	Sub-district Number (RT)	Amount of building	Facility that used (<i>closet</i> type or septic tank)	Technical feasibility of toilet facility (%)
Kelayan Barat	3	50	Not Water Closet; Not Septictank	0
	4	28	Not Water Closet; Not Septictank	0
Murung Raya	17	88	Used Water Closet; Not Septictank	0
Kelayan Tengah	8	13	Water Closet; Not Septictank	0
Tanjung Pagar	22	55	Water Closet; Not Septictank	0
	5	61	Water Closet; Not Septictank	0
	6	71	Water Closet; Not Septictank	0

From the analysis results above, the type of toilet used in the RT. 3 and RT. 4 Kelayan Barat district is not a water closet type but a pit privy/latrine system. Whereas, in all slum areas, sewage disposal does not use septic tank, which means the technical feasibility score for toilet facilities is 0%. So the technical feasibility score for toilet facilities in the slums of the Kelayan River is 0%. To sum up, the water sewage management score does not match the technical requirements is 100% so the parameter assessment is 5.

3.1.8 Waste Management

At this stage of the analysis, considerations are based on the disposal of household waste and the frequency of transporting garbage from the house to the landfill station. For household rubbish disposal, there are several criteria, namely private rubbish bins, communal rubbish bins, dumped into pits / burned, thrown into empty land / roads and thrown into rivers / drainage sewer. Whereas the transportation of waste from the house to the landfill station is assessed based on the frequency of disposal every week. The score for household waste management will be 0% if the frequency of transporting waste from home to landfill station is <1x a week. The results of the analysis can be seen in the following Table 10.

Table 10. Waste Management

District	Sub-district Number (RT)	Household waste disposal	transportation of waste from the house to the landfill station	Household Waste Management Score (%)
Kelayan Barat	3	River	-	0
	4	River	-	0
Murung Raya	17	Landfill	<1x A week	0
Kelayan Tengah	8	Private Rubbish bin	>2x A week	100
Tanjung Pagar	22	Incinerated	<1x A week	0
	5	Incinerated	-	0
	6	Incinerated	-	0

From the analysis results above, it can be seen only RT. 8 Kelayan Tengah district, which throws more than twice as much garbage to the nearest landfill station. Hence, out of 366 householders only 13 householders or as much as 4% dispose of their waste in landfill station more than 2x in a week. From these results it can be concluded that 96% of the management of waste bins is not in accordance with technical requirements.

3.1.9 Fire hazard securement alert

For the analysis of fire safety, the consideration is only in the form of fire protection infrastructure / facilities in each subdistricts. Scores received by fire prevention facilities / infrastructure can be seen in the following Table 11.

Table 11. Fire hazard securement alert

District	Sub-district Number (RT)	Fire prevention facilities	Infrastructure of fire prevention station
Kelayan Barat	3	None	Available
	4	None	Available
Murung Raya	17	Available	Available
Kelayan Tengah	8	None	Available
Tanjung Pagar	22	Available	Available
	5	None	Available
	6	None	Available

From the results analysis above, fire protection facilities such as fire extinguisher and pump cars are not available, but in the city of Banjarmasin generally already have fire trucks in every village. For infrastructure such as the availability of water and fire extinguishers, it is available because it is located in the riverbank area. So as for the protection of fire hazards only the facility that need to be completed in each subdistricts.

4. CONCLUSION

At this stage, the analysis is carried out by scoring according to the parameters set above. The results of the analysis of dominant factors can be seen in Table 12 below.

Table 12. Dominant Factors of the Kelayan Riverside Slum Area

District	Parameter	Score
2 Kelayan Barat, Kelayan Tengah, Murung Raya, Tanjung Pagar	90% of buildings on site have no regularity	3
	22% of buildings have a density that is not according to regulations	1
	33% of buildings on the location did not meet the eligibility requirements of occupancy buildings	1
	32% of the system coverage area is not feasible	1
	0% of the area is not available drainage environment	0
	7% of the population cannot access drinking water and the minimum drinking water needs are not met	0
	100% water sewage management does not comply with technical requirements	3
	96% of household waste management does not comply with technical requirements	3
	0% unavailability of fire protection facilities / infrastructure	0

8
 Scores: Score 0: Excellent, Score 1: Good, Score 2: Fair, Score 3: Poor

From the results of the overall analysis, the dominant factors of slum areas based on physical aspects of slum indicators on the Kelayan Riversides are the regularity of buildings, water sewage management and waste management. After finding the dominant factor, proceed with the hypothesis test for proportions. At this stage, the results of the above factors are hypothesized for proportions. There are five indicators tested in the hypothesis, namely the regularity of buildings, the feasibility of occupancy's buildings, access to drinking water, access to toilet facilities and waste management. It is known as follows:

n= 366 householder

Degree of Freedom (DF) = 5%, 2 side testing, critical point $Z_{\sigma/2} = 1.96$

H0 rejected on $z < -1.96$ or > 1.96

a. Building Regularity

The irregularity of buildings in the Kelayan Riverside slum area is 90%, then it can be calculated in the formula below.

H0: $p = 92\%$ H1: $p \neq 92\%$

$$z = \frac{(\bar{p} - p_0)}{\sqrt{p_0q/n}}$$

$$\begin{aligned}
 &= (0.9 - 0.92) / \sqrt{0.92 \times 0.08 / 366} \\
 &= -0.02 / 0.014 \\
 &= -1.42, z > -1.96, H_0 \text{ accepted.}
 \end{aligned}$$

b. The propeness of building's occupancy

The propeness of building occupancy in the Kelayan Riverside slum area is 67% or 33% of the building is not feasible, so it can be calculated in the formula below.

H₀: p = 37% H₁: p ≠ 37%

$$\begin{aligned}
 z &= \frac{(\bar{p} - p_0)}{\sqrt{p_0q/n}} \\
 &= (0.33 - 0.37) / \sqrt{0.37 \times 0.63 / 366} \\
 &= -0.04 / 0.025 \\
 &= -1.6, z > -1.96, H_0 \text{ accepted.}
 \end{aligned}$$

c. Drinkwater accessibility

People who cannot access drinking water in the slums of the Kelayan Riverside are 7%, counted on the formula below.

H₀: p = 9% H₁: p ≠ 9%

$$\begin{aligned}
 z &= \frac{(\bar{p} - p_0)}{\sqrt{p_0q/n}} \\
 &= (0.07 - 0.09) / \sqrt{0.09 \times 0.81 / 366} \\
 &= -0.02 / 0.014 \\
 &= -1.42, z > -1.96, H_0 \text{ accepted.}
 \end{aligned}$$

d. Toilet Facility Access

Access to toilet facilities in the Kelayan Riverside slum area by 81% so that it can be calculated in the formula below.

H₀: p = 84% H₁: p ≠ 84%

$$\begin{aligned}
 z &= \frac{(\bar{p} - p_0)}{\sqrt{p_0q/n}} \\
 &= (0.81 - 0.84) / \sqrt{0.84 \times 0.16 / 366} \\
 &= -0.03 / 0.019 \\
 &= -1.57, z < -1.96, H_0 \text{ accepted.}
 \end{aligned}$$

e. Waste management

Waste management in the Kelayan Riverside slum area which is not in accordance with the technical requirements of 96% so it can be calculated in the formula below.

H₀: p = 97% H₁: p ≠ 97%

$$\begin{aligned}
 z &= \frac{(\bar{p} - p_0)}{\sqrt{p_0q/n}} \\
 &= (0.96 - 0.97) / \sqrt{0.97 \times 0.03 / 366} \\
 &= -0.01 / 0.01891 \\
 &= -1.12, z > -1.96, H_0 \text{ accepted.}
 \end{aligned}$$

Finally, from the results of the hypothesis test analysis above it can be seen that the closest value can be seen in the following table.

The Analysis Factors of Kelayan's Riverside Settlement Causes
 Slum in the City of Banjarmasin
 Annisa Yuniar

13

Table 13. Analysis Results After the Hypothesis Test

Parameter According to the Sample	Parameter after hypotesys testing
90% of buildings on site have no regularity	92% of buildings on site have no regularity
33% of buildings on the location did not meet the eligibility requirements of occupancy buildings	37% of buildings on the location did not meet the eligibility requirements of occupancy buildings
57% of the population cannot access drinking water and the minimum drinking water needs are not met	59% of the population cannot access drinking water and the minimum drinking water needs are not met
96% of household waste management does not comply with technical requirements	97% of household waste management does not comply with technical requirements

The conclusions obtained from the results of this study are the problems that occur in slums along the riverside with the category of heavy slums, medium slums and mild slums are the irregularity of buildings, waste management and water sewage that pollutes the river. With the similarity of problems in the slums of the Kelayan riverside, although different categories prove that the Kelayan riverside has the same slum characteristics along the river.

REFERENCES

- Badan Pusat Statistik, 2016. *Statistik Daerah Kecamatan Banjarmasin Selatan*.
- Basri, H., dkk. 2010. *Model Penanganan Permukiman Kumuh Studi Kasus Permukiman Kumuh Kelurahan Pontap Kecamatan Wara Timur Kota Palopo* dalam Seminar Nasional – Perumahan Permukiman dalam Pembangunan Kota, Maret 2010.
- Dahliani, 2012. *Konsep Pengolahan Tapak Permukiman di Lahan Rawa Banjarmasin*. Lanting Journal of Architecture. 1 (2): 96 -105.
- Hamidah N., dkk. 2016. *Analisis Permukiman Tepian Sungai yang Berkelanjutan Kasus Permukiman Tepian Sungai Kahayan Kota Palangkaraya* dalam Seminar Inersia, Volume XII Nomor 1, Mei 2016.
- Heryati. 2008. *Identifikasi dan Penanganan Kawasan Kumuh Kota Gorontalo*.
- Imammuddin, M. 2016. *Reuse Air Pada Instalasi Pengolahan Air Limbah (IPAL) Guna Mengurangi Daya Rusak Air di UPT Puskesmas Rawat Inap Ajibata Sumatera Utara* dalam Jurnal Konstruksia, Volume 7 Nomor 2, April 2016.
- Mentayani I. 2016. *Identitas Keruangan Tepian Sungai dan Perubahannya pada Permukiman Vernakular di Banjarmasin* dalam Seminar Nasional-Semesta Arsitektur Nusantara 4, 17-18 November 2016.
- Mentayani I., Nuryanti W., Prayito B., Sarwadi A. 2009. *Aspek-Aspek Tipomorfologi Permukiman Tepi Sungai Kasus: Permukiman Tepian Sungai di Kota Banjarmasin*.
- Walikota Banjarmasin. 2013. *Peraturan Daerah Nomor 5 Tahun 2013 Tentang Rencana Tata Ruang Wilayah (RTRW) Kota Banjarmasin Tahun 2013-2032*.
- Walikota Banjarmasin. 2015. *Surat Keputusan Nomor 460 Tahun 2015 Tentang Penetapan Lokasi Permukiman Kumuh Kota Banjarmasin*.

The Analysis Factors of Kelayan's Riverside Settlement Causes Slum in the City of Banjarmasin

ORIGINALITY REPORT

5%

SIMILARITY INDEX

2%

INTERNET SOURCES

1%

PUBLICATIONS

3%

STUDENT PAPERS

PRIMARY SOURCES

1

Submitted to Universitas Merdeka Malang

Student Paper

2%

2

id.123dok.com

Internet Source

1%

3

www.neliti.com

Internet Source

1%

4

Submitted to Universitas Diponegoro

Student Paper

<1%

5

Deepesh Machiwal, Devi Dayal, Sanjay Kumar. "Estimating Water Balance of Small Reservoirs in Arid Regions: A Case Study from Kachchh, India", Agricultural Research, 2016

Publication

<1%

6

pusatilmiah.blogspot.com

Internet Source

<1%

7

mafiadoc.com

Internet Source

<1%

baadalsg.inflibnet.ac.in

8

Internet Source

<1%

9

akademik.unsoed.ac.id

Internet Source

<1%

10

Najla Amaly. "KUALITAS INFORMASI TERHADAP CITRA DESTINASI PASAR TERAPUNG PADA WISATAWAN DOMESTIK", Alhadharah: Jurnal Ilmu Dakwah, 2017

Publication

<1%

11

es.scribd.com

Internet Source

<1%

12

Submitted to Sriwijaya University

Student Paper

<1%

Exclude quotes Off

Exclude matches Off

Exclude bibliography On